

EPA Region 5 Records Ctr.



298049

Brad Bradley



**LIMITED ASBESTOS SURVEY  
MONTHLY REPORT MAY, 2006**

For the

**ILLINOIS BEACH STATE PARK  
ZION, LAKE COUNTY, ILLINOIS**

Prepared for

**ILLINOIS DEPARTMENT OF  
NATURAL RESOURCES  
REGION 2 OFFICE  
BARTLETT, ILLINOIS**

Prepared by

**Professional Service Industries, Inc.  
4421 Harrison Street  
Hillside, Illinois 60162  
Telephone (708) 236-0720**

**PSI PROJECT NO. 047-5A086**

**June 12, 2006**

June 12, 2006

Ms. Beverly Ascaridis  
Assistant Regional Land Manager  
**Illinois Department of  
Natural Resources**  
Region 2 Office  
2050 West Stearns Road  
Bartlett, Illinois 60103

Reference:      Limited Asbestos Surveys  
                     Monthly Report for May, 2006  
                     Illinois Beach State Park  
                     Zion, Lake County, Illinois  
                     PSI Project No. 047-5A086

Dear Ms. Ascaridis:

In accordance with PSI Proposal No., 047-5A0059-Rev. 1, dated April 11, 2005, and Illinois Department of Natural Resources Contract # G2005085 for ACM investigations at Illinois Beach State Park, PSI is hereby forwarding results of asbestos bulk sampling and analysis performed.

PSI conducted regularly scheduled visual asbestos surveys on a weekly basis during the primary bathing season in the month of May, 2006, covering an estimated 7.2 miles of shoreline at the Illinois Beach State Park. The inspections were performed by Stefan Clouse, an IDPH-Licensed Inspector (#100-09199), and Jeff Chapman, an IDPH-Licensed Inspector (#100-07826). The inspectors documented the location of observed materials suspect of containing asbestos in the daily field log. Documentation includes a visual description of the material, and an assessment of the materials' condition. The coordinates of the material location are provided utilizing a global position system (GPS) that corresponds to a reference map utilizing the United States Geologic Survey (USGS); Zion, Illinois quadrangle. Coordinates are provided in universal transmercator (UTM).

In addition, PSI conducted four additional asbestos surveys at the burn site north of the Zion Nuclear Plant on May 5th, 9th, 12th, and 16th, 2006 per the request of the Illinois Department of Natural Resources. The inspections were performed by Stefan Clouse, an IDPH-Licensed Inspector (#100-09199). The inspector documented the location of observed materials suspect of containing asbestos in the daily field log. Documentation includes a visual description of the material, and an assessment of the materials' condition. The coordinates of the material location are provided utilizing a global position system (GPS) that corresponds to a reference map utilizing the United States Geologic Survey (USGS); Zion, Illinois quadrangle. Coordinates are provided in universal transmercator (UTM).

PSI collected a total of one thousand eight hundred and five (1,805) suspect asbestos containing material samples during our May 2006 inspections. Of the 1,805 suspect materials collected, 1,695 suspect materials were collected from the four burn area inspections. All suspect ACM materials collected were double-bagged and placed as directed in the locked 55 gallon drums on site at the park office. When the current drums are full, the landfill will be contacted to pick up the drums and drop off new ones if necessary. PSI will arrange for pick- up and disposal of ACM material.

All material will be documented under a waste manifest IDNR, as the owner of the ACM material is required to sign the waste manifests.

Note 1: If PLM results for friable materials indicate levels greater than 0% but less than 10% asbestos, the Client has the option to analyze the samples further by point count analysis to better quantify the asbestos content *or assume the material to be asbestos-containing*. Materials having results of point count <1% are considered to be non-asbestos.

Note 2: It should be noted that some ACM might not be accurately identified and/or quantified by PLM. As an example, the original fabrication of vinyl floor tiles routinely involved milling of asbestos fibers to extremely small sizes. As a result, these fibers may go undetected under the standard polarized light microscopy methods. Transmission Electron Microscopy (TEM) is required for a more definitive analysis of these materials. If this situation arises, PSI recommends additional analysis.

In addition a personal air sample, and two field blanks were obtained during our visual inspections, using a constant flow air sampling pump calibrated between 2.0 and 3.0 liters per minute, equipped with a 0.8 micrometer porosity filter mounted in a 25 mm open face cassette. Samples were analyzed utilizing phase contrast microscopy in accordance with NIOSH Method 740 with 400-450X magnification. Air sample results are attached as part of this report.


Attached to this document are results of laboratory analysis, chain of custody documentation PCM air sample analysis, a topographic reference map that utilizes the United States Geologic Survey (USGS); Zion, Illinois quadrangle and applicable accreditations.


PSI warrants that the findings contained herein have been prepared with the level of care and skill exercised by experienced and knowledgeable environmental consultants who are appropriately licensed or otherwise trained to perform asbestos assessments pursuant to OSHA as well as state and local requirements as applicable. It is understood that PSI assumed no liability for the presence of asbestos containing material in areas that were not sampled and tested as described above.

Please do not hesitate to call should there be any questions about the results.

Sincerely,

**Professional Service Industries, Inc.**

  
Ronald Tulke  
Special Project Manager  
Industrial Hygiene Services

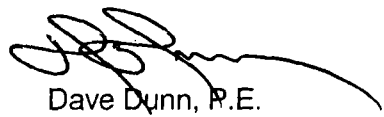  
Dave Dunn, P.E.  
Principal Consultant  
Industrial Hygiene Services

Attachments:      PCM Air Sample Analysis  
                         PLM Sample Analysis  
                         Licenses/Accreditations  
                         Topographic Map

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 04, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION   | SAMPLE LOCATION                             | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|------------------------|---|--------------------------|----------------|
| 05-04-06-01             | Gray transite material | North of Park Office<br>South of Food Stand | 16 433863 E<br>4697790 N | Not Analyzed   |
| 05-04-06-02             | Gray transite material | North of Park Office<br>South of Food Stand | 16 433858 E<br>4697783 N | Not Analyzed   |
| 05-04-06-03             | Gray transite material | North of Park Office<br>South of Food Stand | 16 433864 E<br>4697775 N | Not Analyzed   |
| 05-04-06-04             | Gray transite material | North of Hotel<br>South of Park Office      | 16 433871 E<br>4697198 N | Not Analyzed   |
| 05-04-06-05             | Gray transite material | North of Hotel<br>South of Park Office      | 16 433873 E<br>4697184 N | Not Analyzed   |
| 05-04-06-06             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433881 E<br>4696691 N | Not Analyzed   |
| 05-04-06-07             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433907 E<br>4696165 N | Not Analyzed   |
| 05-04-06-08             | Gray transite material | North of Hotel<br>South of Park Office      | 16 433916 E<br>4695789 N | Not Analyzed   |
| 05-04-06-09             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433909 E<br>4695817 N | Not Analyzed   |
| 05-04-06-10             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433878 E<br>4696603 N | Not Analyzed   |
| 05-04-06-11             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433892 E<br>4696810 N | Not Analyzed   |
| 05-04-06-12             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433884 E<br>4697069 N | Not Analyzed   |
| 05-04-06-13             | Gray transite material | North of Park Office<br>South of Food Stand | 16 433864 E<br>4697554 N | Not Analyzed   |
| 05-04-06-14             | Gray transite material | North of Food Stand<br>South of Zion        | 16 433941 E<br>4698617 N | Not Analyzed   |
| 05-04-06-15             | Gray transite material | North of Zion<br>South of North Pier        | 16 434271 E<br>4700616 N | Not Analyzed   |
| 05-04-06-16             | Gray transite material | North of Zion<br>South of North Pier        | 16 434257 E<br>4700987 N | Not Analyzed   |
| 05-04-06-17             | Gray transite material | North of Zion<br>South of North Pier        | 16 434314 E<br>4701970 N | Not Analyzed   |
| 05-04-06-18             | Gray transite material | North of Zion<br>South of North Pier        | 16 434338 E<br>4701964 N | Not Analyzed   |
| 05-04-06-19             | Gray transite material | North of Zion<br>South of North Pier        | 16 434343 E<br>4702667 N | Not Analyzed   |
| 05-04-06-20             | Gray transite material | North of Zion<br>South of North Pier        | 16 434351 E<br>4702643 N | Not Analyzed   |
| 05-04-06-21             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433871 E<br>4696976 N | Not Analyzed   |
| 05-04-06-22             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433892 E<br>4697006 N | Not Analyzed   |
| 05-04-06-23             | Gray transite material | North of Dead River<br>South of Hotel       | 16 433892 E<br>4697004 N | Not Analyzed   |
|                         |                        |   |                          |                |
|                         |                        |   |                          |                |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 5, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-05-06-01             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | 15% Chrysotile |
| 05-05-06-02             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-03             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-04             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-05             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-06             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-07             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-08             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-09             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-10             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-11             | Transite shingle     | North of Zion, Driveway 2 | 16 434023 E<br>4701341 N | Not Analyzed   |
| 05-05-06-12             | Transite shingle     | North of Zion, Driveway 2 | 16 434032 E<br>4701344 N | Not Analyzed   |
| 05-05-06-13             | Transite shingle     | North of Zion, Driveway 2 | 16 434032 E<br>4701344 N | Not Analyzed   |
| 05-05-06-14             | Transite shingle     | North of Zion, Driveway 2 | 16 434032 E<br>4701344 N | Not Analyzed   |
| 05-05-06-15             | Transite shingle     | North of Zion, Driveway 2 | 16 434032 E<br>4701344 N | Not Analyzed   |
| 05-05-06-16             | Transite shingle     | North of Zion, Driveway 2 | 16 434032 E<br>4701344 N | Not Analyzed   |
| 05-05-06-17             | Transite shingle     | North of Zion, Driveway 2 | 16 434032 E<br>4701344 N | Not Analyzed   |
| 05-05-06-18             | Transite shingle     | North of Zion, Driveway 2 | 16 434027 E<br>4701352 N | Not Analyzed   |
| 05-05-06-19             | Transite shingle     | North of Zion, Driveway 2 | 16 434027 E<br>4701352 N | Not Analyzed   |
| 05-05-06-20             | Transite shingle     | North of Zion, Driveway 2 | 16 434027 E<br>4701352 N | Not Analyzed   |
| 05-05-06-21             | Transite shingle     | North of Zion, Driveway 2 | 16 434027 E<br>4701352 N | Not Analyzed   |
| 05-05-06-22             | Transite shingle     | North of Zion, Driveway 2 | 16 434027 E<br>4701352 N | Not Analyzed   |
| 05-05-06-23             | Transite shingle     | North of Zion, Driveway 2 | 16 434027 E<br>4701352 N | Not Analyzed   |
| 05-05-06-24             | Transite shingle     | North of Zion, Driveway 2 | 16 434027 E<br>4701352 N | Not Analyzed   |
| 05-05-06-25             | Transite shingle     | North of Zion, Driveway 2 | 16 434027 E<br>4701352 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 5, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-05-06-26             | Transite piping      | North of Zion, Driveway 2 | 16 434083 E<br>4701463 N | Not Analyzed   |
| 05-05-06-27             | Transite piping      | North of Zion, Driveway 2 | 16 434083 E<br>4701463 N | Not Analyzed   |
| 05-05-06-28             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-29             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-30             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-31             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-32             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-33             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-34             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-35             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-36             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-37             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-38             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-39             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-40             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-41             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-42             | Transite shingle     | North of Zion, Driveway 3 | 16 434086 E<br>4701474 N | Not Analyzed   |
| 05-05-06-43             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-44             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-45             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-46             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-47             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-48             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-49             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-50             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 5, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-05-06-51             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-52             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-53             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-54             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-55             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-56             | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701477 N | Not Analyzed   |
| 05-05-06-57             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-58             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-59             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-60             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-61             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-62             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-63             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-64             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-65             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-66             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-67             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-68             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-69             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-70             | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701478 N | Not Analyzed   |
| 05-05-06-71             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-72             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-73             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-74             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-75             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 5, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-05-06-76             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-77             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-78             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-79             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-80             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-81             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-82             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-83             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-84             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-85             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-86             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-87             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-88             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-89             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-90             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-91             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-92             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-93             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-94             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-95             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-96             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-97             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-98             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-99             | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-100            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 5, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-05-06-101            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-102            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-103            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-104            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-105            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-106            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-107            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-108            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-109            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-110            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-111            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-112            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-113            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-114            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-115            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-116            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-117            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-118            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-119            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-120            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-121            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-122            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-123            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-124            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-125            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 5, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-05-06-126            | Transite shingle     | North of Zion, Driveway 3 | 16 434062 E<br>4701488 N | Not Analyzed   |
| 05-05-06-127            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-128            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-129            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-130            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-131            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-132            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-133            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-134            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-135            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-136            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-137            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-138            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-139            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-140            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-141            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-142            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-143            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-144            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-145            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-146            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-147            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-148            | Transite shingle     | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-149            | Transite piping      | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |
| 05-05-06-150            | Transite piping      | North of Zion, Driveway 3 | 16 434078 E<br>4701476 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 5, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-05-06-151            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-152            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-153            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-154            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-155            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-156            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-157            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-158            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-159            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-160            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-161            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-162            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-163            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-164            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-165            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-166            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-167            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-168            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-169            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-170            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-171            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-172            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-173            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-174            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |
| 05-05-06-175            | Transite shingle     | North of Zion, Driveway 3 | 16 434077 E<br>4701479 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 5, 2006**

**Limited Asbestos Survey Illinois Beach State Park  
Zion, Lake County, Illinois**

[illegible]

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-01             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | 15% Chrysotile |
| 05-09-06-02             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-03             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-04             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-05             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-06             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-07             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-08             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-09             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-10             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-11             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-12             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-13             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-14             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-15             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-16             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-17             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-18             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-19             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-20             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-21             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-22             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-23             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-24             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-25             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-26             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-27             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-28             | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701430 N | Not Analyzed   |
| 05-09-06-29             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-30             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-31             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-32             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-33             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-34             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-35             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-36             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-37             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-38             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-39             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-40             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-41             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-42             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-43             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-44             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-45             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-46             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-47             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-48             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-49             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-50             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-51             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-52             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-53             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-54             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-55             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-56             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-57             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-58             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-59             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-60             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-61             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-62             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-63             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-64             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-65             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-66             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-67             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-68             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-69             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-70             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-71             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-72             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-73             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-74             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-75             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-76             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-77             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-78             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-79             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-80             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-81             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-82             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-83             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-84             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-85             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-86             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-87             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-88             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-89             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-90             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-91             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-92             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-93             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-94             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-95             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-96             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-97             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-98             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-99             | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-100            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-101            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-102            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-103            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-104            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-105            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-106            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-107            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-108            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-109            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-110            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-111            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-112            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701428 N | Not Analyzed   |
| 05-09-06-113            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-114            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-115            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-116            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-117            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-118            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-119            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-120            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-121            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-122            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-123            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-124            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-125            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-126            | Transite shingle     | North of Zion, Driveway 3 | 16 434113 E<br>4701418 N | Not Analyzed   |
| 05-09-06-127            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-128            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-129            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-130            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-131            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-132            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-133            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-134            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-135            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-136            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-137            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-138            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-139            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-140            | Transite shingle     | North of Zion, Driveway 3 | 16 434140 E<br>4701421 N | Not Analyzed   |
| 05-09-06-141            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-142            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-143            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-144            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-145            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-146            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-147            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-148            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-149            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-150            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-151            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-152            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-153            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-154            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-155            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-156            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-157            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-158            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-159            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-160            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-161            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-162            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-163            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-164            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-165            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-166            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-167            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |
| 05-09-06-168            | Transite shingle     | North of Zion, Driveway 3 | 16 434137 E<br>4701438 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-05-169            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-170            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-171            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-172            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-173            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-174            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-175            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-176            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-177            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-178            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-179            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-180            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-181            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-182            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-183            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-184            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-185            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-186            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-187            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-188            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-189            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-190            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-191            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-192            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-193            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-194            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-195            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-196            | Transite shingle     | North of Zion, Driveway 3 | 16 434089 E<br>4701436 N | Not Analyzed   |
| 05-09-06-197            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-198            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-199            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-200            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-201            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-202            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-203            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-204            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-205            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-206            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-207            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-208            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-209            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-210            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-211            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-212            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-213            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-214            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-215            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-216            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-217            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-218            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-219            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-220            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-221            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-222            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-223            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-224            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701433 N | Not Analyzed   |
| 05-09-06-225            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-226            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-227            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-228            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-229            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-230            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-231            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-232            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-233            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-234            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-235            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-236            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-237            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-238            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-239            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-240            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-241            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-242            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-243            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-244            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-245            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-246            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-247            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-248            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-249            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-250            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-251            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-252            | Transite shingle     | North of Zion, Driveway 3 | 16 434085 E<br>4701431 N | Not Analyzed   |
| 05-09-06-253            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-254            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-255            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-256            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-257            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-258            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-259            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-260            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-261            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-262            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-263            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-264            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-265            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-266            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-267            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-268            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-269            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-270            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-271            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-272            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-273            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-274            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-275            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-276            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-277            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-278            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-279            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-280            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-281            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-282            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-283            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-284            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-285            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-286            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-287            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-288            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-289            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-290            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-291            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-292            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-293            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-294            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701432 N | Not Analyzed   |
| 05-09-06-295            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-296            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-297            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-298            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-299            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-300            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-301            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-302            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-303            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-304            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-305            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-306            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-307            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-308            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-309            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-310            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-311            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-312            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-313            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-314            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-315            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-316            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-317            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-138            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-139            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-320            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-321            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-322            | Transite shingle     | North of Zion, Driveway 3 | 16 434080 E<br>4701428 N | Not Analyzed   |
| 05-09-06-323            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-324            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-325            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-326            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-327            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-328            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-329            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-330            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-331            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-332            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-333            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-334            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-335            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-336            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-337            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-338            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-339            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-340            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-341            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-342            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-343            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-344            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-345            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-346            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-347            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-348            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-349            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-350            | Transite shingle     | North of Zion, Driveway 3 | 16 434092 E<br>4701415 N | Not Analyzed   |
| 05-09-06-351            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-352            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-353            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-354            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-355            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-356            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-357            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-358            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-359            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |
| 05-09-06-360            | Transite shingle     | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-361                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-362                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-363                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-364                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-365                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-366                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-367                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-368                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-369                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-370                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-371                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-372                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-373                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-374                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-375                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-376                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-377                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-378                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-379                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-380                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-381                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-382                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-383                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-384                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-385                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-386                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-387                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-388                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-389                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-390                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-391                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-392                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-393                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-394                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-395                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-396                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-397                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-398                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-399                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-400                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-401                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-402                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-403                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-404                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-405                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-406                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-407                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-408                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-409                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-410                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-411                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-412                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-413                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-414                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-415                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-416                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-417                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-418                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-419                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-420                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-421                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-422                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-423                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-424                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-425                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-426                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-427                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-428                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-429                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-430                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-431                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-432                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-433                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-434                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701412 N | Not Analyzed          |
| 05-09-06-435                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-436                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-437                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-438                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-439                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-440                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-441                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-442                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-443                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-444                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-445                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-446                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-447                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-448                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-449                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-450                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-451                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-452                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-453                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-454                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-455                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-456                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-457                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-458                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-459                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-460                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-461                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-462                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-463                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-464                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-465                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-466                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-467                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-468                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-469                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-470                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-471                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-472                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-473                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-474                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-475                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-476                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701414 N | Not Analyzed          |
| 05-09-06-477                   | Transite shingle            | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed          |
| 05-09-06-478                   | Transite shingle            | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed          |
| 05-09-06-479                   | Transite shingle            | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed          |
| 05-09-06-480                   | Transite shingle            | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-481            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-482            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-483            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-484            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-485            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-486            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-487            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-488            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-489            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-490            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-491            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-492            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-493            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-494            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-495            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-496            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-497            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-498            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-499            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-500            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-501            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-502            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-503            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-504            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-09-06-505            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-506            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-507            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-508            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-509            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-510            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-511            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-512            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-513            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-514            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-515            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-516            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-517            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-518            | Transite shingle     | North of Zion, Driveway 3 | 16 434099 E<br>4701428 N | Not Analyzed   |
| 05-09-06-519            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-520            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-521            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-522            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-523            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-524            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-525            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-526            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-527            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |
| 05-09-06-528            | Transite shingle     | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-529                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-530                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-531                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-532                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-533                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-534                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-535                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-536                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-537                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-538                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-539                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-540                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-541                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-542                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-543                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-544                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-545                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-546                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-547                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-548                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-549                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-550                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-551                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-552                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-553                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-554                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-555                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-556                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-557                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-558                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-559                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-560                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-561                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-562                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-563                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-564                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-565                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-566                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-567                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-568                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-569                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-570                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-571                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-572                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-573                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-574                   | Transite shingle            | North of Zion, Driveway 3 | 16 434097 E<br>4701419 N | Not Analyzed          |
| 05-09-06-575                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-576                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-577                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-578                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-579                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-580                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-581                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-582                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-583                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-584                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-585                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-586                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-587                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-588                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-589                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-590                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-591                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-592                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-593                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-594                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-595                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-596                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-597                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-598                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-599                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-600                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-601                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-602                   | Transite shingle            | North of Zion, Driveway 3 | 16 434094 E<br>4701417 N | Not Analyzed          |
| 05-09-06-603                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-604                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-605                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-606                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-607                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-608                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-609                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-610                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-611                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-612                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-613                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-614                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-615                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-616                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-617                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-618                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-619                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-620                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-621                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-622                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-623                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-624                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-625                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-626                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-627                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-628                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-629                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-630                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-631                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-632                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-633                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-634                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-635                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-636                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-637                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-638                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-639                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-640                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-641                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-642                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-643                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-644                   | Transite shingle            | North of Zion, Driveway 3 | 16 434095 E<br>4701415 N | Not Analyzed          |
| 05-09-06-645                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-646                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-647                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-648                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-649                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-650                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-651                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-652                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-653                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-654                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-655                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-656                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-657                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-658                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-659                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-660                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-661                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-662                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-663                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-664                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-665                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-666                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-667                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-668                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-669                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-670                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-671                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |
| 05-09-06-672                   | Transite shingle            | North of Zion, Driveway 3 | 16 434102 E<br>4701413 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-673                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-674                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-675                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-676                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-677                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-678                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-679                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-680                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-681                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-682                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-683                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-684                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-685                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-686                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-687                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-688                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-689                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-690                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-691                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-692                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-693                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-694                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-695                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-696                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-697                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-698                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-699                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-700                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-701                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-702                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-703                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-704                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-705                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-706                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-707                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-708                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-709                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-710                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-711                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-712                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-713                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-714                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-715                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-716                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-717                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-718                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-719                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-720                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-721                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-722                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-723                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-724                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-725                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-726                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-727                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-728                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-729                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-730                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-731                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-732                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-733                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-734                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-735                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-736                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-737                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-738                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-739                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-740                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-741                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-742                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-743                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-744                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-09-06-745                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-746                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-747                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-748                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-749                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-750                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-751                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-752                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-753                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-754                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-755                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-756                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-757                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-758                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-759                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-760                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-761                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-762                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-763                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-764                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-765                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-766                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-767                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |
| 05-09-06-768                   | Transite shingle            | North of Zion, Driveway 3 | 16 434091 E<br>4701404 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 9, 2006**

**Limited Asbestos Survey Illinois Beach State Park  
Zion, Lake County, Illinois**

[illegible]

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 10, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION    | SAMPLE LOCATION                             | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|-------------------------|---|--------------------------|----------------|
| 05-10-06-01             | Gray transite material  | North of Office<br>South of Food Store      | 16 433863 E<br>4697428 N | Not Analyzed   |
| 05-10-06-02             | Gray transite material  | North of Office<br>South of Food Store      | 16 433868 E<br>4697696 N | Not Analyzed   |
| 05-10-06-03             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433915 E<br>4695952 N | Not Analyzed   |
| 05-10-06-04             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433922 E<br>4695938 N | Not Analyzed   |
| 05-10-06-05             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433918 E<br>4695846 N | Not Analyzed   |
| 05-10-06-06             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433892 E<br>4696229 N | Not Analyzed   |
| 05-10-06-07             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433892 E<br>4696229 N | Not Analyzed   |
| 05-10-06-08             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433871 E<br>4696502 N | Not Analyzed   |
| 05-10-06-09             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433872 E<br>4696510 N | Not Analyzed   |
| 05-10-06-10             | White transite material | North of Dead River<br>South of Hotel       | 16 433900 E<br>4696556 N | Not Analyzed   |
| 05-10-06-11             | White transite material | North of Main Beach<br>South of Zion        | 16 433986 E<br>4698787 N | Not Analyzed   |
| 05-10-06-12             | Black transite material | North of Main Beach<br>South of Zion        | 16 433990 E<br>4698807 N | Not Analyzed   |
| 05-10-06-13             | Gray transite material  | North of Zion<br>South of North Pier        | 16 434279 E<br>4700588 N | Not Analyzed   |
| 05-10-06-14             | Gray transite material  | North of Zion<br>South of North Pier        | 16 434255 E<br>4700934 N | Not Analyzed   |
| 05-10-06-15             | Gray transite material  | North of Zion<br>South of North Pier        | 16 434313 E<br>4701817 N | Not Analyzed   |
| 05-10-06-16             | Gray transite material  | North of Zion<br>South of North Pier        | 16 434311 E<br>4701848 N | Not Analyzed   |
| 05-10-06-17             | Gray transite material  | North of Zion<br>South of North Pier        | 16 434312 E<br>4701846 N | Not Analyzed   |
| 05-10-06-18             | Gray transite material  | North of Zion<br>South of North Pier        | 16 434312 E<br>4701845 N | Not Analyzed   |
| 05-10-06-19             | Gray transite material  | North of Zion<br>South of North Pier        | 16 434358 E<br>4702635 N | Not Analyzed   |
| 05-10-06-20             | Gray transite material  | North of Zion<br>South of North Pier        | 16 434354 E<br>4702640 N | Not Analyzed   |
| 05-10-06-21             | Gray transite material  | North of Park Office<br>South of Food Store | 16 433863 E<br>4697526 N | Not Analyzed   |
| 05-10-06-22             | Gray transite material  | North of Park Office<br>South of Food Store | 16 433863 E<br>4697450 N | Not Analyzed   |
| 05-10-06-23             | Gray transite material  | North of Hotel<br>South of Park Office      | 16 433872 E<br>4697394 N | Not Analyzed   |
| 05-10-06-24             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433883 E<br>4696742 N | Not Analyzed   |
| 05-10-06-25             | Gray transite material  | North of Dead River<br>South of Hotel       | 16 433868 E<br>4696816 N | Not Analyzed   |

**Limited Asbestos Survey Illinois Beach State Park  
Zion, Lake County, Illinois**

[illegible]

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>   | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|--------------------------|--------------------------|-----------------------|
| 05-12-06-01                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | 15% Chrysotile        |
| 05-12-06-02                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-03                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-04                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-05                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-06                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-07                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-08                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-09                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-10                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-11                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-12                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-13                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-14                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-15                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-16                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-17                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-18                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-19                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-20                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-21                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-22                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-23                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-24                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-25                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>   | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|--------------------------|--------------------------|-----------------------|
| 05-12-06-26                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-27                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-28                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-29                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-30                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-31                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-32                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-33                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-34                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-35                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-36                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-37                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-38                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-39                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-40                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-41                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-42                    | Transite shingle            | North of Zion, Back Area | 16 433550 E<br>4701011 N | Not Analyzed          |
| 05-12-06-43                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-44                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-42                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-46                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-47                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-48                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-49                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-50                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>   | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|--------------------------|--------------------------|-----------------------|
| 05-12-06-51                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-52                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-53                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-54                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-55                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-56                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-57                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-58                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-59                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-60                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-61                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-62                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-63                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-64                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-65                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-66                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-67                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-68                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-69                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-70                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-71                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-72                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-73                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-74                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-75                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>   | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|--------------------------|--------------------------|-----------------------|
| 05-12-06-76                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-77                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-78                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-79                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-80                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-81                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-82                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-83                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-84                    | Transite shingle            | North of Zion, Back Area | 16 433561 E<br>4701005 N | Not Analyzed          |
| 05-12-06-85                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-86                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-87                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-88                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-89                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-90                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-91                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-92                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-93                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-94                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-95                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-96                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-97                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-98                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-99                    | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-100                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>   | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|--------------------------|--------------------------|-----------------------|
| 05-12-06-101                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-102                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-103                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-104                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-105                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-106                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-107                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-108                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-109                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-110                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-111                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-112                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701001 N | Not Analyzed          |
| 05-12-06-113                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-114                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-115                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-116                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-117                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-118                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-119                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-120                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-121                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-122                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-123                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-124                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-125                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>   | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|--------------------------|--------------------------|-----------------------|
| 05-12-06-126                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-127                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-128                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-129                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-130                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-131                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-132                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-133                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-134                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-135                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-136                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-137                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-138                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-139                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-140                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-141                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-142                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-143                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-144                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-145                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-146                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-147                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-148                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-149                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-150                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>   | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|--------------------------|--------------------------|-----------------------|
| 05-12-06-151                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-152                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-153                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-154                   | Transite shingle            | North of Zion, Back Area | 16 433560 E<br>4701006 N | Not Analyzed          |
| 05-12-06-155                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-156                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-157                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-158                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-159                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-160                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-161                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-162                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-163                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-164                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-165                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-166                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-167                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-168                   | Transite shingle            | North of Zion, Back Area | 16 433565 E<br>4701005 N | Not Analyzed          |
| 05-12-06-169                   | Transite pipe               | North of Zion, Back Area | 16 433611 E<br>4701010 N | Not Analyzed          |
| 05-12-06-170                   | Transite pipe               | North of Zion, Back Area | 16 433611 E<br>4701010 N | Not Analyzed          |
| 05-12-06-171                   | Transite pipe               | North of Zion, Back Area | 16 433611 E<br>4701010 N | Not Analyzed          |
| 05-12-06-172                   | Transite pipe               | North of Zion, Back Area | 16 433611 E<br>4701010 N | Not Analyzed          |
| 05-12-06-173                   | Transite pipe               | North of Zion, Back Area | 16 433611 E<br>4701010 N | Not Analyzed          |
| 05-12-06-174                   | Transite pipe               | North of Zion, Back Area | 16 433611 E<br>4701010 N | Not Analyzed          |
| 05-12-06-175                   | Transite pipe               | North of Zion, Back Area | 16 433611 E<br>4701010 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-12-06-176            | Transite pipe        | North of Zion, Back Area  | 16 433611 E<br>4701010 N | Not Analyzed   |
| 05-12-06-177            | Transite pipe        | North of Zion, Back Area  | 16 433611 E<br>4701010 N | Not Analyzed   |
| 05-12-06-178            | Transite pipe        | North of Zion, Back Area  | 16 433611 E<br>4701010 N | Not Analyzed   |
| 05-12-06-179            | Transite pipe        | North of Zion, Back Area  | 16 433611 E<br>4701010 N | Not Analyzed   |
| 05-12-06-180            | Transite pipe        | North of Zion, Back Area  | 16 433611 E<br>4701010 N | Not Analyzed   |
| 05-12-06-181            | Transite pipe        | North of Zion, Back Area  | 16 433611 E<br>4701010 N | Not Analyzed   |
| 05-12-06-182            | Transite pipe        | North of Zion, Back Area  | 16 433611 E<br>4701010 N | Not Analyzed   |
| 05-12-06-183            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-184            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-185            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-186            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-187            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-188            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-189            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-190            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-191            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-192            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-193            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-194            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-195            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-196            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-197            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-198            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-199            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |
| 05-12-06-200            | Transite shingle     | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-12-06-201                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-202                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-203                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-204                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-205                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-206                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-207                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-208                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-209                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-210                   | Transite shingle            | North of Zion, Driveway 1 | 16 434031 E<br>4701979 N | Not Analyzed          |
| 05-12-06-211                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-212                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-213                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-214                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-215                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-216                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-217                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-218                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-219                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-220                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-221                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-222                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-223                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-224                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-225                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-12-06-226                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-227                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-228                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-229                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-230                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-231                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-232                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-233                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-234                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-235                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-236                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-237                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-238                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-239                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-240                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-241                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-242                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-243                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-244                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-245                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-246                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-247                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-248                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-249                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-250                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-12-06-251                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-252                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-253                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-254                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-255                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-256                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-257                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-258                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-259                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-260                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-261                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-262                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-263                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-264                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-265                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-266                   | Transite shingle            | North of Zion, Driveway 2 | 16 433977 E<br>4701305 N | Not Analyzed          |
| 05-12-06-267                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-268                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-269                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-270                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-271                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-272                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-273                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-274                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-275                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-12-06-276                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-277                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-278                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-279                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-280                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-281                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-282                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-283                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-284                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-285                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-286                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-287                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-288                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-289                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-290                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-291                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-292                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-293                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-294                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-295                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-296                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-297                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-298                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-299                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-300                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-12-06-301                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-302                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-303                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-304                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-305                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-306                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-307                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-308                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-309                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-310                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-311                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-312                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-313                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-314                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-315                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-316                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-317                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-318                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-319                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-320                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-321                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-322                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-323                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-324                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-325                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 12, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-12-06-326                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-327                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-328                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-329                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-330                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-331                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-332                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-333                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-334                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-335                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-336                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-337                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-338                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-339                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-340                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-341                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-342                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-343                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-344                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-345                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-346                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-347                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-348                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-349                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |
| 05-12-06-350                   | Transite shingle            | North of Zion, Driveway 2 | 16 433713 E<br>4701329 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS                   |
|-------------------------|----------------------|---------------------------|--------------------------|----------------------------------|
| 05-16-06-01             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | 5% Crocidolite<br>25% Chrysotile |
| 05-16-06-02             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-03             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-04             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-05             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-06             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-07             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-08             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-09             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-10             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-11             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-12             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-13             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-14             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-15             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-16             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-17             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-18             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-19             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-20             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-21             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-22             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-23             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-24             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |
| 05-16-06-25             | Transite shingle     | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed                     |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-26                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-27                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-28                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-29                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-30                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-31                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-32                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-33                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-34                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-35                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-36                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-37                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-38                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-39                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-40                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-41                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-42                    | Transite shingle            | North of Zion, Driveway 2 | 16 433986 E<br>4701320 N | Not Analyzed          |
| 05-16-06-43                    | Transite shingle            | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed          |
| 05-16-06-44                    | Transite shingle            | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed          |
| 05-16-06-45                    | Transite shingle            | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed          |
| 05-16-06-46                    | Transite shingle            | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed          |
| 05-16-06-47                    | Transite shingle            | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed          |
| 05-16-06-48                    | Transite shingle            | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed          |
| 05-16-06-49                    | Transite shingle            | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed          |
| 05-16-06-50                    | Transite shingle            | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-16-06-51             | Transite shingle     | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed   |
| 05-16-06-52             | Transite shingle     | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed   |
| 05-16-06-53             | Transite shingle     | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed   |
| 05-16-06-54             | Transite shingle     | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed   |
| 05-16-06-55             | Transite shingle     | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed   |
| 05-16-06-56             | Transite shingle     | North of Zion, Driveway 3 | 16 434069 E<br>4701481 N | Not Analyzed   |
| 05-16-06-57             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-58             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-59             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-60             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-61             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-62             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-63             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-64             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-65             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-66             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-67             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-68             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-69             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-70             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-71             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-72             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-73             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-74             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |
| 05-16-06-75             | Transite shingle     | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-76                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-77                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-78                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-79                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-80                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-81                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-82                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-83                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-84                    | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701476 N | Not Analyzed          |
| 05-16-06-85                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-86                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-87                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-88                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-89                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-90                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-91                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-92                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-93                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-94                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-95                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-96                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-97                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-98                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-99                    | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-100                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-101                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-102                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-103                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-104                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-105                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-106                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-107                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-108                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-109                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-110                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-111                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-112                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-113                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-114                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-115                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-116                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-117                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-118                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-119                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-120                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-121                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-122                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-123                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-124                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |
| 05-16-06-125                   | Transite shingle            | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| SAMPLE IDENTIFICATION # | MATERIAL DESCRIPTION | SAMPLE LOCATION           | GPS COORDINATES          | SAMPLE RESULTS |
|-------------------------|----------------------|---------------------------|--------------------------|----------------|
| 05-16-06-126            | Transite shingle     | North of Zion, Driveway 3 | 16 434067 E<br>4701475 N | Not Analyzed   |
| 05-16-06-127            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-128            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-129            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-130            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-131            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-132            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-133            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-134            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-135            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-136            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-137            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-138            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-139            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-140            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-141            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-142            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-143            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-144            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-145            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-146            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-147            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-148            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-149            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |
| 05-16-06-150            | Transite shingle     | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed   |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-151                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed          |
| 05-16-06-152                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed          |
| 05-16-06-153                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed          |
| 05-16-06-154                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701465 N | Not Analyzed          |
| 05-16-06-155                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-156                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-157                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-158                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-159                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-160                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-161                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-162                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-163                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-164                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-165                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-166                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-167                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-168                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-169                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-170                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-171                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-172                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-173                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-174                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-175                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-176                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-177                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-178                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-179                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-180                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-181                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-182                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-183                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-184                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-185                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-186                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-187                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-188                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-189                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-190                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-191                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-192                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-193                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-194                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-195                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-196                   | Transite shingle            | North of Zion, Driveway 3 | 16 434060 E<br>4701459 N | Not Analyzed          |
| 05-16-06-197                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-198                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-199                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-200                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-201                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-202                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-203                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-204                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-205                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-206                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-207                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-208                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-209                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-210                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-211                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-212                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-213                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-214                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-215                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-216                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-217                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-218                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-219                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-220                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-221                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-222                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-223                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-224                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-225                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-226                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-227                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-228                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-229                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-230                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-231                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-232                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-233                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-234                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-235                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-236                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-237                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-238                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-239                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-240                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-241                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-242                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-243                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-244                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-245                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-246                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-247                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-248                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-249                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-250                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-251                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-252                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-253                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-254                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-255                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-256                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-257                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-258                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-259                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-260                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-261                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-262                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-263                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-264                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-265                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-266                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-267                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-268                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-269                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-270                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-271                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-272                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-273                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-274                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-275                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-276                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-277                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-278                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-279                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-280                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-281                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-282                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-283                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-284                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-285                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-286                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-287                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-288                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-289                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-290                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-291                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-292                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-293                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-294                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-295                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-296                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-297                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-298                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-299                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-300                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-301                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-302                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-303                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-304                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-305                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-306                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-307                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-308                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-309                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-310                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-311                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-312                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-313                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-314                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-315                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-316                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-317                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-318                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-319                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-320                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-321                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-322                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701459 N | Not Analyzed          |
| 05-16-06-323                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-324                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-325                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------|--------------------------|-----------------------|
| 05-16-06-326                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-327                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-328                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-329                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-330                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-331                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-332                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-333                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-334                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-335                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-336                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-337                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-338                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-339                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-340                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-341                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-342                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-343                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-344                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-345                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-346                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-347                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-348                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-349                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |
| 05-16-06-350                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>    | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b>            |
|--------------------------------|-----------------------------|---------------------------|--------------------------|----------------------------------|
| 05-16-06-351                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | 5% Crocidolite<br>25% Chrysotile |
| 05-16-06-352                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-353                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-354                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-355                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-356                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-357                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-358                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-359                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-360                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-361                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-362                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-363                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-364                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-365                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-366                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-367                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-368                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-369                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-370                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-371                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-372                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-373                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-374                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |
| 05-16-06-375                   | Transite shingle            | North of Zion, Driveway 3 | 16 434063 E<br>4701456 N | Not Analyzed                     |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 16, 2006**

**Limited Asbestos Survey Illinois Beach State Park  
Zion, Lake County, Illinois**

[illegible]

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 18, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>                      | <b>GPS COORDINATES</b>   | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---|--------------------------|-----------------------|
| 05-18-06-01                    | Gray transite material      | North of Hotel<br>South of Park Office      | 16 433814 E<br>4697439 N | Not Analyzed          |
| 05-18-06-02                    | Gray transite material      | North of Hotel<br>South of Park Office      | 16 433867 E<br>4697411 N | Not Analyzed          |
| 05-18-06-03                    | Gray transite material      | North of Hotel<br>South of Park Office      | 16 433863 E<br>4697416 N | Not Analyzed          |
| 05-18-06-04                    | Gray transite material      | North of Hotel<br>South of Park Office      | 16 433869 E<br>4697361 N | Not Analyzed          |
| 05-18-06-05                    | Gray transite material      | North of Dead River<br>South of Hotel       | 16 433924 E<br>4695850 N | Not Analyzed          |
| 05-18-06-06                    | Gray transite material      | North of Dead River<br>South of Hotel       | 16 433920 E<br>4695735 N | Not Analyzed          |
| 05-18-06-07                    | Gray transite material      | North of Dead River<br>South of Hotel       | 16 433915 E<br>4695952 N | Not Analyzed          |
| 05-18-06-08                    | White transite material     | North of Dead River<br>South of Hotel       | 16 433912 E<br>4696087 N | Not Analyzed          |
| 05-18-06-09                    | Gray transite material      | North of Dead River<br>South of Hotel       | 16 433894 E<br>4696830 N | Not Analyzed          |
| 05-18-06-10                    | Gray transite material      | North of Hotel<br>South of Park Office      | 16 433869 E<br>4697234 N | Not Analyzed          |
| 05-18-06-11                    | Gray transite material      | North of Park Office<br>South of Food Stand | 16 433851 E<br>4697517 N | Not Analyzed          |
| 05-18-06-12                    | Gray transite material      | North of Park Office<br>South of Food Stand | 16 433862 E<br>4697540 N | Not Analyzed          |
| 05-18-06-13                    | Gray transite material      | North of Park Office<br>South of Food Stand | 16 433859 E<br>4697574 N | Not Analyzed          |
| 05-18-06-14                    | Gray transite material      | North of Park Office<br>South of Food Stand | 16 433858 E<br>4697585 N | Not Analyzed          |
| 05-18-06-15                    | Gray transite material      | North of Park Office<br>South of Food Stand | 16 433855 E<br>4697657 N | Not Analyzed          |
| 05-18-06-16                    | Gray transite material      | North of Food Stand<br>South of Zion        | 16 433874 E<br>4697850 N | Not Analyzed          |
| 05-18-06-17                    | Gray transite material      | North of Food Stand<br>South of Zion        | 16 433872 E<br>4697869 N | Not Analyzed          |
| 05-18-06-18                    | Gray transite material      | North of Food Stand<br>South of Zion        | 16 433926 E<br>4698577 N | Not Analyzed          |
| 05-18-06-19                    | Gray transite material      | North of Zion<br>South of North Pier        | 16 434260 E<br>4700934 N | Not Analyzed          |
| 05-18-06-20                    | Gray transite material      | North of Zion<br>South of North Pier        | 16 434264 E<br>4700914 N | Not Analyzed          |
| 05-18-06-21                    | Gray transite material      | North of Zion<br>South of North Pier        | 16 434316 E<br>4701771 N | Not Analyzed          |
| 05-18-06-22                    | Gray transite material      | North of Zion<br>South of North Pier        | 16 434366 E<br>4701998 N | Not Analyzed          |
| 05-18-06-23                    | Gray transite material      | North of Zion<br>South of North Pier        | 16 434365 E<br>4701993 N | Not Analyzed          |
| 05-18-06-24                    | Gray transite material      | North of Zion<br>South of North Pier        | 16 434361 E<br>4701973 N | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 18, 2006**

**Limited Asbestos Survey Illinois Beach State Park  
Zion, Lake County, Illinois**

[illegible]

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 26, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>                | <b>GPS COORDINATES</b>     | <b>SAMPLE RESULTS</b> |
|--------------------------------|-----------------------------|---------------------------------------|----------------------------|-----------------------|
| 05-26-06-01                    | Gray transite material      | Front of hotel                        | 16 4242370 E<br>08780364 N | Not Analyzed          |
| 05-26-06-02                    | Gray transite material      | South of Hotel<br>North of Dead River | 16 4242174 W<br>08780364 N | 15% Chrysotile        |
| 05-26-06-03                    | Gray transite material      | South of Hotel<br>North of Dead River | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-04                    | Gray transite material      | South of Hotel<br>North of Dead River | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-05                    | Gray transite material      | South of Hotel<br>North of Dead River | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-06                    | Gray transite material      | South of Hotel<br>North of Dead River | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-07                    | Gray transite material      | South of Hotel<br>North of Dead River | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-08                    | Gray transite material      | South of Hotel<br>North of Dead River | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-09                    | Gray transite material      | South of Hotel<br>North of Dead River | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-10                    | Gray transite material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-11                    | Gray transite material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-12                    | Gray transite material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-13                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Negative              |
| 05-26-06-14                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Negative              |
| 05-26-06-15                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Negative              |
| 05-26-06-16                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-17                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-18                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-19                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-20                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-21                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-22                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-23                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-24                    | Black roofing material      | North of Hotel<br>South of Zion       | 16 424 E<br>08780364 N     | Not Analyzed          |

The following material types were sampled as part of this survey and their results are summarized in the table below:

**May 26, 2006**  
**Limited Asbestos Survey Illinois Beach State Park**  
**Zion, Lake County, Illinois**

| <b>SAMPLE<br/>IDENTIFICATION #</b> | <b>MATERIAL DESCRIPTION</b> | <b>SAMPLE LOCATION</b>           | <b>GPS<br/>COORDINATES</b> | <b>SAMPLE RESULTS</b> |
|------------------------------------|-----------------------------|----------------------------------|----------------------------|-----------------------|
| 05-26-06-25                        | Black roofing material      | North of Hotel<br>South of Zion  | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-26                        | Gray transite material      | North of Hotel<br>South of Zion  | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-27                        | Gray transite material      | North of Zion<br>South of Marina | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-28                        | Gray transite material      | North of Zion<br>South of Marina | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-29                        | Gray transite material      | North of Zion<br>South of Marina | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-30                        | Gray transite material      | North of Zion<br>South of Marina | 16 424 E<br>08780364 N     | Not Analyzed          |
| 05-26-06-31                        | Gray transite material      | North of Zion<br>South of Marina | 16 424 E<br>08780364 N     | Not Analyzed          |

ASBESTOS AIR SAMPLING FORM

Project No.: 047-50086  
Client: IDNR  
Site Name: ISPB  
& Location: ISPB

Date Sampled: 5/4/06  
Sampled by: S. CLUNE  
Contractor:

Samples Used for TWA

8-Hour TWA

|                             |           |           |                             |  |  |  |
|-----------------------------|-----------|-----------|-----------------------------|--|--|--|
| SAMPLE NO.                  | 050406-01 | 050406-02 | 050406-03                   |  |  |  |
| ACTIVITY                    | /         | /         | INSPECTION                  |  |  |  |
| LOCATION                    | /         | /         | ISPB                        |  |  |  |
| NAME/SSN                    | /         | /         | STEFAN CLUNE<br>342-78-6973 |  |  |  |
| SAMPLE TYPE                 | B         | B         | PR5                         |  |  |  |
| PUMP ID                     | /         | /         | 3                           |  |  |  |
| START TIME                  | /         | /         | 06:40                       |  |  |  |
| STOP TIME                   | /         | /         | 13:40                       |  |  |  |
| TOTAL ELAPSED TIME (T)      | /         | /         | 420                         |  |  |  |
| FLOW RATE (START/STOP/AVG.) | /         | /         | 2.1 2.1 2.1                 |  |  |  |
| VOLUME                      | 0         | 0         | 882                         |  |  |  |
| FIBERS COUNTED              | ND        | ND        | ND                          |  |  |  |
| FIELDS COUNTED              | 100       | 100       | 100                         |  |  |  |
| FIBERS/FIELDS               | /         | /         | /                           |  |  |  |
| FIBERS/CC *                 | /         | /         | /                           |  |  |  |
| FIBERS/mm <sup>3</sup>      | /         | /         | /                           |  |  |  |
| TYPE OF RESPIRATORS         | /         | /         | /                           |  |  |  |
| LLOQ                        | /         | /         | /                           |  |  |  |

General Comments:

\* Corrected for blank count.

- NOTES: (1) Analytical Method: NIOSH Method 7400, not specific for asbestos. Cassettes: 25mm unless otherwise noted.  
(2) Working range of Method 7400 is: 100 to 1300 fibers/mm<sup>3</sup>. Limit of Quantitation (LOQ) = 100 fibers/mm<sup>3</sup>. Limit of Detection (LOD) = 7 fibers/mm<sup>3</sup>.  
(3) Where fiber density is less than 100 fibers/mm<sup>3</sup>, greater sample volumes are recommended if feasible.  
(4) FIBERS/cc = [(FIBERS/FIELD) (ECA)] / [(1000) (FR) (T) (MFA)]

REMARKS: This laboratory is enrolled in the American Industrial Hygiene Association Proficiency Analytical Testing Program (PAT).

Analyzed By:

*[Signature]*

Date Analyzed:

5/17/06

**SAMPLE TYPE**

B - BLANK  
BG - BACKGROUND  
A - AREA  
IWA - INSIDE WORK AREA  
OWA - OUTSIDE WORK AREA  
HE - HEPA EXHAUST  
P - PERSONNEL  
E - EXCURSION

# ASBESTOS AIR SAMPLING FORM

Project No.: 047-50096  
Client: IBNR  
Site Name  
& Location: ISPB

Date Sampled: 5/9/06  
Sampled by: S. CLOUSE  
Contractor: \_\_\_\_\_

Samples Used for TWA

8-Hour TWA

|                             |           |           |               |  |  |  |
|-----------------------------|-----------|-----------|---------------|--|--|--|
| SAMPLE NO.                  | 050906-01 | 050906-02 | 050906-03     |  |  |  |
| ACTIVITY                    | /         | /         | INSPECTION    |  |  |  |
| LOCATION                    | /         | /         | ISPB          |  |  |  |
| NAME/SSN                    | /         | /         | STEFAN CLOUSE |  |  |  |
| SAMPLE TYPE                 | B         | B         | PRS           |  |  |  |
| PUMP ID                     | /         | /         | 291           |  |  |  |
| START TIME                  | /         | /         | 06:45         |  |  |  |
| STOP TIME                   | /         | /         | 13:15         |  |  |  |
| TOTAL ELAPSED TIME (T)      | /         | /         | 790           |  |  |  |
| FLOW RATE (START/STOP/AVG.) | /         | /         | 2.1 2.1 2.1   |  |  |  |
| VOLUME                      | φ         | φ         | 819           |  |  |  |
| FIBERS COUNTED              | NO        | NO        | 1             |  |  |  |
| FIELDS COUNTED              | 100       | 100       | 100           |  |  |  |
| FIBERS/FIELDS               | /         | /         | 0.01          |  |  |  |
| FIBERS/CC*                  | /         | /         | 0.0006        |  |  |  |
| FIBERS/mm <sup>3</sup>      | /         | /         |               |  |  |  |
| TYPE OF RESPIRATORS         | /         | /         |               |  |  |  |
| LOQ                         | /         | /         |               |  |  |  |

General Comments: \_\_\_\_\_

\* Corrected for blank count.

NOTES: (1) Analytical Method: NIOSH Method 7400, not specific for asbestos. Cassettes: 25mm unless otherwise noted.  
(2) Working range of Method 7400 is 100 to 1300 fibers/mm<sup>3</sup>. Limit of Quantitation (LOQ) = 100 fibers/mm<sup>3</sup>. Limit of Detection (LOD) = 7 fibers/mm<sup>3</sup>.  
(3) Where fiber density is less than 100 fibers/mm<sup>3</sup>, greater sample volumes are recommended if feasible.  
(4)  $FIBERS/cc = (FIBERS/FIELD)(ECA)/(1000)(FR)(T)(MFA)$

REMARKS: This laboratory is enrolled in the American Industrial Hygiene Association Proficiency Analytical Testing Program (PAT).

Analyzed By: [Signature]

Date Analyzed: 5/17/06

## SAMPLE TYPE

B - BLANK  
BG - BACKGROUND  
A - AREA  
IWA - INSIDE WORK AREA  
OWA - OUTSIDE WORK AREA  
HE - HEPA EXHAUST  
P - PERSONNEL  
E - EXCURSION

# ASBESTOS AIR SAMPLING FORM

Project No.: 047-5A086  
Client: IDNR  
Site Name:  
& Location: ISPB

Date Sampled: 5/10/06  
Sampled by: S. C. LOUSE  
Contractor:

Samples Used for TWA

8-Hour TWA

|                             |           |           |                 |  |  |  |
|-----------------------------|-----------|-----------|-----------------|--|--|--|
| SAMPLE NO.                  | 05/006-01 | 05/006-02 | 05/006-03       |  |  |  |
| ACTIVITY                    | /         | /         | INSPECTION      |  |  |  |
| LOCATION                    | /         | /         | ISPB            |  |  |  |
| NAME/SSN                    | /         | /         | STEFAN<br>LOUSE |  |  |  |
| SAMPLE TYPE                 | B         | B         | PRS             |  |  |  |
| PUMP ID                     | /         | /         | 291             |  |  |  |
| START TIME                  | /         | /         | 06:45           |  |  |  |
| STOP TIME                   | /         | /         | 13:15           |  |  |  |
| TOTAL ELAPSED TIME (T)      | /         | /         | 390             |  |  |  |
| FLOW RATE (START/STOP/AVG.) | /         | /         | 2.1 2.1 2.1     |  |  |  |
| VOLUME                      | φ         | φ         | 819             |  |  |  |
| FIBERS COUNTED              | ND        | ND        | 2               |  |  |  |
| FIELDS COUNTED              | 100       | 100       | 100             |  |  |  |
| FIBERS/FIELDS               | /         | /         | 0.02            |  |  |  |
| FIBERS/CC *                 | /         | /         | 0.001           |  |  |  |
| FIBERS/mm <sup>3</sup>      | /         | /         |                 |  |  |  |
| TYPE OF RESPIRATORS         | /         | /         |                 |  |  |  |
| LI.OO                       | /         | /         |                 |  |  |  |

General Comments:

\* Corrected for blank count.

NOTES: (1) Analytical Method: NIOSH Method 7400, not specific for asbestos. Cassettes: 25mm unless otherwise noted.  
(2) Working range of Method 7400 is 100 to 1300 fibers/mm<sup>3</sup>. Limit of Quantitation (LOQ) = 100 fibers/mm<sup>3</sup>. Limit of Detection (LOD) = 7 fibers/mm<sup>3</sup>.  
(3) Where fiber density is less than 100 fibers/mm<sup>3</sup>, greater sample volumes are recommended if feasible.  
(4)  $FIBERS/cc = ((FIBERS/FIELD) * (ECA)) / ((1000) * (FR) * (T) * (MFA))$

REMARKS: This laboratory is enrolled in the American Industrial Hygiene Association Proficiency Analytical Testing Program (PAT).

Analyzed By:

Date Analyzed:

## SAMPLE TYPE

B - BLANK  
BG - BACKGROUND  
A - AREA  
IWA - INSIDE WORK AREA  
OWA - OUTSIDE WORK AREA  
HE - HEPA EXHAUST  
P - PERSONNEL  
E - EXCURSION

ASBESTOS AIR SAMPLING FORM

Project No.: 042-5A086  
Client: IDNR  
Site Name  
& Location: ISPB

Date Sampled: 5/12/06  
Sampled by: S. CLOUSE  
Contractor: /

Samples Used for TWA

8-Hour TWA

|                             |                  |                  |                      |  |  |  |
|-----------------------------|------------------|------------------|----------------------|--|--|--|
| SAMPLE NO.                  | <u>05/206-01</u> | <u>05/206-02</u> | <u>05/206-03</u>     |  |  |  |
| ACTIVITY                    | /                | /                | <u>INSPECTION</u>    |  |  |  |
| LOCATION                    | /                | /                | <u>ISPB</u>          |  |  |  |
| NAME/SSN                    | /                | /                | <u>STEFAN CLOUSE</u> |  |  |  |
| SAMPLE TYPE                 | <u>B</u>         | <u>B</u>         | <u>PRS</u>           |  |  |  |
| PUMP ID                     | /                | /                | <u>291</u>           |  |  |  |
| START TIME                  | /                | /                | <u>06:45</u>         |  |  |  |
| STOP TIME                   | /                | /                | <u>10:25</u>         |  |  |  |
| TOTAL ELAPSED TIME (T)      | /                | /                | <u>400</u>           |  |  |  |
| FLOW RATE (START/STOP/AVG.) | /                | /                | <u>2.1 2.1 2.1</u>   |  |  |  |
| VOLUME                      | <u>0</u>         | <u>0</u>         | <u>840</u>           |  |  |  |
| FIBERS COUNTED              | <u>ND</u>        | <u>ND</u>        | <u>ND</u>            |  |  |  |
| FIELDS COUNTED              | <u>100</u>       | <u>100</u>       | <u>100</u>           |  |  |  |
| FIBERS/FIELDS               | /                | /                | /                    |  |  |  |
| FIBERS/CC *                 | /                | /                | /                    |  |  |  |
| FIBERS/mm <sup>3</sup>      | /                | /                | /                    |  |  |  |
| TYPE OF RESPIRATORS         | /                | /                | /                    |  |  |  |
| LOD                         | /                | /                | /                    |  |  |  |

General Comments:

\* Corrected for blank count.

NOTES: (1) Analytical Method: NIOSH Method 7400, not specific for asbestos. Cassettes: 25mm unless otherwise noted.  
(2) Working range of Method 7400 is 100 to 1300 fibers/mm<sup>3</sup>. Limit of Quantitation (LOQ) = 100 fibers/mm<sup>3</sup>. Limit of Detection (LOD) = 7 fibers/mm<sup>3</sup>.  
(3) Where fiber density is less than 100 fibers/mm<sup>3</sup>, greater sample volumes are recommended if feasible.  
(4) FIBERS/cc = [(FIBERS/FIELD)(ECA)]/[(1000)(FR)(T)(MFA)]

REMARKS: This laboratory is enrolled in the American Industrial Hygiene Association Proficiency Analytical Testing Program (PAT).

Analyzed By: [Signature]

Date Analyzed: 5/17/06

**SAMPLE TYPE**

B - BLANK  
BG - BACKGROUND  
A - AREA  
IWA - INSIDE WORK AREA  
OWA - OUTSIDE WORK AREA  
HE - HEPA EXHAUST  
P - PERSONNEL  
E - EXCURSION

# ASBESTOS AIR SAMPLING FORM

Project No.: 047-5A086  
Client: IDNR  
Site Name: ISPB  
& Location: ISPB

Date Sampled: 5/16/06  
Sampled by: S. CLAUSE  
Contractor: \_\_\_\_\_

Samples Used for TWA

8-Hour TWA

|                             |           |           |                  |  |  |  |
|-----------------------------|-----------|-----------|------------------|--|--|--|
| SAMPLE NO.                  | 051606-01 | 051606-02 | 051606-03        |  |  |  |
| ACTIVITY                    | /         | /         | INSPECTION       |  |  |  |
| LOCATION                    | /         | /         | ISPB             |  |  |  |
| NAME/SSN                    | /         | /         | STEFAN<br>CLAUSE |  |  |  |
| SAMPLE TYPE                 | B         | B         | PRS              |  |  |  |
| PUMP ID                     | /         | /         | 291              |  |  |  |
| START TIME                  | /         | /         | 06:45            |  |  |  |
| STOP TIME                   | /         | /         | 13:15            |  |  |  |
| TOTAL ELAPSED TIME (T)      | /         | /         | 390              |  |  |  |
| FLOW RATE (START/STOP/AVG.) | /         | /         | 2.1 2.1 2.1      |  |  |  |
| VOLUME                      | /         | /         | 819              |  |  |  |
| FIBERS COUNTED              | ND        | ND        | 2.5              |  |  |  |
| FIELDS COUNTED              | 100       | 100       | 100              |  |  |  |
| FIBERS/FIELDS               | /         | /         | 0.025            |  |  |  |
| FIBERS/CC *                 | /         | /         | 0.001            |  |  |  |
| FIBERS/mm <sup>3</sup>      | /         | /         |                  |  |  |  |
| TYPE OF RESPIRATORS         | /         | /         |                  |  |  |  |
| LLOQ                        | /         | /         |                  |  |  |  |

General Comments: \_\_\_\_\_

\* Corrected for blank count.

- NOTES: (1) Analytical Method: NIOSH Method 7400, not specific for asbestos. Cassettes: 25mm unless otherwise noted.  
(2) Working range of Method 7400 is 100 to 1300 fibers/mm<sup>3</sup>. Limit of Quantitation (LOQ) = 100 fibers/mm<sup>3</sup>. Limit of Detection (LOD) = 7 fibers/mm<sup>3</sup>.  
(3) Where fiber density is less than 100 fibers/mm<sup>3</sup>, greater sample volumes are recommended if feasible.  
(4) FIBERS/cc = ((FIBERS/FIELD) \* (ECA)) / ((1000 \* (FR) \* (T) \* (MFA)))

REMARKS: This laboratory is enrolled in the American Industrial Hygiene Association Proficiency Analytical Testing Program (PAT).

Analyzed By: [Signature]

Date Analyzed: 5/17/06

## SAMPLE TYPE

B - BLANK  
BG - BACKGROUND  
A - AREA  
IWA - INSIDE WORK AREA  
OWA - OUTSIDE WORK AREA  
HE - HEPA EXHAUST  
P - PERSONNEL  
E - EXCURSION

ASBESTOS AIR SAMPLING FORM

Project No.: 04750086  
Client: IDNR  
Site Name: ISPB  
Location: ISPB

Date Sampled: 5/17/06  
Sampled by: S. Clout  
Contractor:

Samples Used for TWA

8-Hour TWA

|                             |            |           |              |  |  |  |
|-----------------------------|------------|-----------|--------------|--|--|--|
| SAMPLE NO.                  | 05/706-01  | 05/706-02 | 05/706-03    |  |  |  |
| ACTIVITY                    | INSPECTION |           |              |  |  |  |
| LOCATION                    | ISPB       |           |              |  |  |  |
| NAME/SSN                    | /          | /         | STEVEN CLONE |  |  |  |
| SAMPLE TYPE                 | B          | B         | PRS          |  |  |  |
| PUMP ID                     | /          | /         | 291          |  |  |  |
| START TIME                  | /          | /         | 06:40        |  |  |  |
| STOP TIME                   | /          | /         | 11:40        |  |  |  |
| TOTAL ELAPSED TIME (T)      | /          | /         | 300          |  |  |  |
| FLOW RATE (START/STOP/AVG.) | /          | /         | 2.2 2.2 2.2  |  |  |  |
| VOLUME                      | /          | /         | 660          |  |  |  |
| FIBERS COUNTED              | 0          | 0         | 26           |  |  |  |
| FIELDS COUNTED              | 100        | 100       | 100          |  |  |  |
| FIBERS/FIELDS               | 0          | 0         | 0.26         |  |  |  |
| FIBERS/CC *                 | /          | /         | 0.019        |  |  |  |
| FIBERS/mm <sup>2</sup>      | /          | /         |              |  |  |  |
| TYPE OF RESPIRATOR          | /          | /         |              |  |  |  |
| LLOQ                        | /          | /         | 0.058        |  |  |  |

General Comments:

\* Corrected for blank count.

- NOTES: (1) Analytical Method: NIOSH Method 7400, not specific for asbestos. Cassettes: 25mm unless otherwise noted.  
(2) Working range of Method 7400 is 100 to 1300 fibers/mm<sup>2</sup>. Limit of Quantitation (LOQ) = 100 fibers/mm<sup>2</sup>. Limit of Detection (LOD) = 7 fibers/mm<sup>2</sup>.  
(3) Where fiber density is less than 100 fibers/mm<sup>2</sup>, greater sample volumes are recommended if feasible.  
(4)  $FIBERS/cc = ((FIBERS/FIELD) \cdot (ECA)) / ((1000)(FR)(T)(MFA))$

REMARKS: This laboratory is enrolled in the American Industrial Hygiene Association Proficiency Analytical Testing Program (PAT).

Analyzed By: W. C. F.

Date Analyzed: 6/16/06

**SAMPLE TYPE**

- B - BLANK  
BG - BACKGROUND  
A - AREA  
IWA - INSIDE WORK AREA  
OWA - OUTSIDE WORK AREA  
HE - HEPA EXHAUST  
P - PERSONNEL  
E - EXCURSION

# ASBESTOS AIR SAMPLING FORM

Project No.: 047-SAC89  
Client: INDR  
Site Name  
& Location: IBSP

Date Sampled: 5.26.06  
Sampled by: JC  
Contractor: N/A

Samples Used for TWA

8-Hour TWA

|                             |            |            |              |  |  |  |
|-----------------------------|------------|------------|--------------|--|--|--|
| SAMPLE NO.                  | 5-26-06-01 | 5-26-06-02 | 5-26-06-03   |  |  |  |
| ACTIVITY                    |            |            |              |  |  |  |
| LOCATION                    |            |            | IBSP         |  |  |  |
| NAME/SSN                    |            |            | JEFF CHAPMAN |  |  |  |
| SAMPLE TYPE                 | B          | B          | P            |  |  |  |
| PUMP ID                     |            |            |              |  |  |  |
| START TIME                  |            |            | 700          |  |  |  |
| STOP TIME                   |            |            | 1200         |  |  |  |
| TOTAL ELAPSED TIME (T)      |            |            | 300          |  |  |  |
| FLOW RATE (START/STOP/AVG.) |            |            | 2 2 2        |  |  |  |
| VOLUME                      |            |            | 600          |  |  |  |
| FIBERS COUNTED              | 1          | 1          | 3            |  |  |  |
| FIELDS COUNTED              | 100        | 100        | 100          |  |  |  |
| FIBERS/FIELDS               | .01        | .01        | .03          |  |  |  |
| FIDERS/CC *                 |            |            | 0.002        |  |  |  |
| FIBERS/mm <sup>2</sup>      |            |            |              |  |  |  |
| TYPE OF RESPIRATORS         |            |            |              |  |  |  |
| LOO                         |            |            |              |  |  |  |

General Comments:

\* Corrected for blank count.

- NOTES: (1) Analytical Method: NIOSH Method 7400, not specific for asbestos. Cassettes: 25mm unless otherwise noted.  
(2) Working range of Method 7400 is: 100 to 1300 fibers/mm<sup>2</sup>. Limit of Quantitation (LOQ) = 100 fibers/mm<sup>2</sup>. Limit of Detection (LOD) = 7 fibers/mm<sup>2</sup>.  
(3) Where fiber density is less than 100 fibers/mm<sup>2</sup>, greater sample volumes are recommended if feasible.  
(4) FIDERS/cc = [(FIBERS/FIELD) (500) (FR) (TIME)]

REMARKS: This laboratory is enrolled in the American Industrial Hygiene Association Proficiency Analytical Testing Program (PAT).

Analyzed By:

Date Analyzed:

5.26.06

## SAMPLE TYPE

B - BLANK  
BG - BACKGROUND  
A - AREA  
IWA - INSIDE WORK AREA  
OWA - OUTSIDE WORK AREA  
HE - HEPA EXHAUST  
P - PERSONNEL  
E - EXCURSION

## REPORT OF BULK SAMPLE ANALYSIS FOR ASBESTOS

TESTED FOR: PSI, Inc  
4421 Harrison Rd., Ste. 510  
Hillside, IL 60162  
Attn: Ron Tulke

Project ID: 047-5A086  
IDNR

Date Received: 5/22/2006

Date Completed: 5/24/2006

Date Reported: 5/24/2006

Analyst: SB

Work Order: 0605406

Page: 1 of 1

| Client ID | Lab ID<br>(Layer) | Sample Description<br>(Color, Texture, Etc.)<br><i>Analyst's Comment</i> | Asbestos<br>Content<br>(Percent and Type) | Non-asbestos<br>Fibers<br>(Percent and Type) |
|-----------|-------------------|--|---|--|
| 01-01     | 001A              | (1) Tan, Transite, Homogeneous   | 15% Chrysotile                            | None Reported                                |
| 01-02     | 002A              | Sample Not Tested  |   |  |
| 01-03     | 003A              | Sample Not Tested  |   |  |

Report Notes: (PT) Point Count Results

Quantitation is based on a visual estimation of the relative area of bulk sample components, unless otherwise noted in the "Comments" section of this report. The results are valid only for the item tested. This report may not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. Method used: E.P.A. Method for the Determination of Asbestos in Bulk Building Materials (EPA / 600/R-93/116 July 1993). Polarized Light Microscopy is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Quantitative Transmission Electron Microscopy is currently the only method that can be used to determine if the material can be considered or treated as non-asbestos containing. Samples will be disposed of within 30 days unless notified in writing by the client. No part of this report may be reproduced, except in full, without written permission of the laboratory. The reporting limit is 1% by weight.

Respectfully submitted,  
PSI, Inc.

*Maureen L. Sammons*  
Approved Signatory  
Maureen Sammons



## REPORT OF BULK SAMPLE ANALYSIS FOR ASBESTOS

TESTED FOR: PSI, Inc  
4421 Harrison Rd., Ste. 510  
Hillside, IL 60162  
Attn: Ron Tulke

Project ID: 047-5A086  
IDNR

Date Received: 5/22/2006

Date Completed: 5/24/2006

Date Reported: 5/24/2006

| Analyst: SB   |                | Work Order: 0605407   |                                     | Page: 1 of 1                           |  |
|---------------|----------------|---|-------------------------------------|--|--|
| Client ID     | Lab ID (Layer) | Sample Description (Color, Texture, Etc.)<br><i>Analyst's Comment</i> | Asbestos Content (Percent and Type) | Non-asbestos Fibers (Percent and Type) |  |
| 01-01         | 001A           | (1) Tan, Transite, Homogeneous  | 15% Chrysotile                      | None Reported                          |  |
| 01-02         | 002A           | Sample Not Tested   |                                     |  |  |
| 01-03         | 003A           | Sample Not Tested   |                                     |  |  |
| Report Notes: |                | (PT) Point Count Results  |                                     |  |  |

Quantitation is based on a visual estimation of the relative area of bulk sample components, unless otherwise noted in the "Comments" section of this report. The results are valid only for the item tested. This report may not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. Method used: E.P.A. Method for the Determination of Asbestos in Bulk Building Materials (EPA / 600/R-93/116 July 1993). Polarized Light Microscopy is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Quantitative Transmission Electron Microscopy is currently the only method that can be used to determine if the material can be considered or treated as non-asbestos containing. Samples will be disposed of within 30 days unless notified in writing by the client. No part of this report may reproduced, except in full, without written permission of the laboratory. The reporting limit is 1% by weight.

Respectfully submitted,  
PSI, Inc.

*Maureen L. Sammons*  
Approved Signatory  
Maureen Sammons



## REPORT OF BULK SAMPLE ANALYSIS FOR ASBESTOS

TESTED FOR: PSI, Inc  
4421 Harrison Rd., Ste. 510  
Hillside, IL 60162  
Attn: Ron Tulke

Project ID: 047-5A086  
IDNR

Date Received: 5/22/2006

Date Completed: 5/24/2006

Date Reported: 5/24/2006

Analyst: SB

Work Order: 0605410

Page: 1 of 1

| Client ID | Lab ID<br>(Layer) | Sample Description<br>(Color, Texture, Etc.)<br><i>Analyst's Comment</i> | Asbestos<br>Content<br>(Percent and Type) | Non-asbestos<br>Fibers<br>(Percent and Type) |
|-----------|-------------------|--|---|--|
| 01-01     | 001A              | (1) Tan, Transite, Homogeneous   | 15% Chrysotile                            | None Reported                                |
| 01-02     | 002A              | Sample Not Tested  |   |  |
| 01-03     | 003A              | Sample Not Tested  |   |  |

Report Notes: (PT) Point Count Results

Quantitation is based on a visual estimation of the relative area of bulk sample components, unless otherwise noted in the "Comments" section of this report. The results are valid only for the item tested. This report may not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. Method used: E.P.A. Method for the Determination of Asbestos in Bulk Building Materials (EPA / 600/R-93/116 July 1993). Polarized Light Microscopy is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Quantitative Transmission Electron Microscopy is currently the only method that can be used to determine if the material can be considered or treated as non-asbestos containing. Samples will be disposed of within 30 days unless notified in writing by the client. No part of this report may be reproduced, except in full, without written permission of the laboratory. The reporting limit is 1% by weight.

Respectfully submitted,  
PSI, Inc.

*Maureen L. Sammons*  
Approved Signatory  
Maureen Sammons

**psi** Information  
To Build On  
Seminars • Conferences • Meetings

0605410

☐ 850 Poplar Street  
Pittsburgh, PA 15220  
412/222-4000

~~OTHER~~ PSI

[illegible]

| SAMPLE IDENTIFICATION | DATE / TIME | APRA<br>BLK-B<br>DUST-D<br>NOB-N<br>PAINT-P | SCX-S<br>VIOLEN-V<br>WASTE-X<br>WATER-W<br>WPE-WP |
|-----------------------|-------------|---|---|
| 01/01-03              | 4/29/06     |   | B   |
| 01/01-03              | 4/28/06     |   |   |
| 01/01-03              | 5/5/04      |   |   |
| 01/01-03              | 5/9/06      |   |   |
| 01/01-03              | 5/12/06     |   |   |

ADDITIONAL REMARKS: ~~X~~ STOP AT FIRST POSITIVE FOR EACH DAY

**SAMPLER'S SIGNATURE**

7. John M. Lane  
Your signature denotes agreement with the FBI General Conditions which are printed on the back side of this document.

FED EX#- 857.9 1023 2184

## REPORT OF BULK SAMPLE ANALYSIS FOR ASBESTOS

TESTED FOR: PSI, Inc  
4421 Harrison Rd., Ste. 510  
Hillside, IL 60162  
Attn: Ron Tulke

Project ID: 047-5A086  
IDNR  
Old 173

Date Received: 5/18/2006

Date Completed: 5/19/2006

Date Reported: 5/19/2006

| Analyst: DA |                   | Work Order: 0605347  |   | Page: 1 of 1              |  |
|-------------|-------------------|--|---|---------------------------|--|
| Client ID   | Lab ID<br>(Layer) | Sample Description<br>(Color, Texture, Etc.)<br><i>Analyst's Comment</i> | Asbestos<br>Content<br>(Percent and Type) |                           | Non-asbestos<br>Fibers<br>(Percent and Type) |
| 01-01       | 001A              | (1) Gray, Transite, Homogeneous  | 5%<br>25%                                 | Crocidolite<br>Chrysotile | None Reported                                |
| 01-02       | 002A              | Sample Not Tested  |   |                           |  |
| 01-03       | 003A              | Sample Not Tested  |   |                           |  |

Report Notes: (PT) Point Count Results

Quantitation is based on a visual estimation of the relative area of bulk sample components, unless otherwise noted in the "Comments" section of this report. The results are valid only for the item tested. This report may not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. Method used: E.P.A. Method for the Determination of Asbestos in Bulk Building Materials (EPA / 600/R-93/116 July 1993). Polarized Light Microscopy is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Quantitative Transmission Electron Microscopy is currently the only method that can be used to determine if the material can be considered or treated as non-asbestos containing. Samples will be disposed of within 30 days unless notified in writing by the client. No part of this report may be reproduced, except in full, without written permission of the laboratory. The reporting limit is 1% by weight.

Respectfully submitted,  
PSI, Inc.

*Maureen L. Sammons*

Approved Signatory  
Maureen Sammons

**psi** Information  
To Build On  
Engineering • Consulting • Testing

LABORATORY SUBMITTED TO:

☐ 850 Poplar Street  
Pittsburgh, PA 15220  
412/922-4000

☒ OTHER PS.

## PARAMETER LIST

NUMBER OF CONTAINERS

ADDITIONAL REMARKS *X STOP AT FIRST POSITIVE.*

**SAMPLER'S SIGNATURE**

Your signature denotes agreement with the PSI General Conditions which are printed on the back side of this document.

## REPORT OF BULK SAMPLE ANALYSIS FOR ASBESTOS

TESTED FOR: PSI, Inc  
4421 Harrison Rd., Ste. 510  
Hillside, IL 60162  
Attn: Ron Tulke

Project ID: 047-5A086  
IDNR

Date Received: 5/30/2006

Date Completed: 6/5/2006

Date Reported: 6/5/2006

| Analyst: PH |                | Work Order: 0605553   |                                     | Page: 1 of 1                           |                    |
|-------------|----------------|---|-------------------------------------|--|--------------------|
| Client ID   | Lab ID (Layer) | Sample Description (Color, Texture, Etc.)<br><i>Analyst's Comment</i> | Asbestos Content (Percent and Type) | Non-asbestos Fibers (Percent and Type) |                    |
| 5-26-06-02  | 001A           | (1) Gray, Not Provided, Homogeneous                                   | 15% Chrysotile                      | None Reported                          |                    |
| 5-26-06-05  | 002A           | Sample Not Tested   |                                     |  |                    |
| 5-26-06-10  | 003A           | Sample Not Tested   |                                     |  |                    |
| 5-26-06-13  | 004A           | (1) Red, Not Provided, Homogeneous                                    | NO ASBESTOS DETECTED                | 3% Synthetic Fiber                     | 7% Cellulose fiber |
| 5-26-06-14  | 005A           | (1) Red, Not Provided, Homogeneous                                    | NO ASBESTOS DETECTED                | 3% Synthetic Fiber                     | 7% Cellulose fiber |
| 5-26-06-15  | 006A           | (1) Red, Not Provided, Homogeneous                                    | NO ASBESTOS DETECTED                | 3% Synthetic Fiber                     | 7% Cellulose fiber |

Report Notes: (PT) Point Count Results

Quantitation is based on a visual estimation of the relative area of bulk sample components, unless otherwise noted in the "Comments" section of this report. The results are valid only for the item tested. This report may not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. Method used: E.P.A. Method for the Determination of Asbestos in Bulk Building Materials (EPA / 600/R-93/116 July 1993). Polarized Light Microscopy is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Quantitative Transmission Electron Microscopy is currently the only method that can be used to determine if the material can be considered or treated as non-asbestos containing. Samples will be disposed of within 30 days unless notified in writing by the client. No part of this report may reproduced, except in full, without written permission of the laboratory. The reporting limit is 1% by weight.

Respectfully submitted,  
PSI, Inc.

*Maureen L. Sammons*  
Approved Signatory  
Maureen Sammons

# CHAIN OF CUSTODY RECORD

**PSI** Information  
To Build On  
Engineering • Consulting • Testing

|   |  |                           |
|---|--|---------------------------|
| PROJECT NAME<br><b>IDNK</b>                     | REPORT TO<br><b>RON TULKE</b>  | INVOICE TO<br><b>Same</b> |
| PROJECT NUMBER<br><b>047-5A086</b>              | PROJECT MANAGER<br><b>JEFF CHAMMAN</b>   | ADDRESS                   |
| P.O. NUMBER                                     | ADDRESS<br><b>4421 Harrison</b>  | CITY / STATE / ZIP        |
| REQUIRED DUE DATE (MM-DD-YY)<br><b>24th JAN</b> | CITY / STATE / ZIP<br><b>Hillside IL</b>   | ATTENTION                 |
| SAMPLES TO LAB VIA<br><b>FedEx</b>              | TELEPHONE<br><b>708 236 0760</b>   | TELEPHONE                 |
| NUMBER OF COOLERS/PACKAGES                      | FAX  |                           |
|   | REPORT DATA VIA<br><input type="checkbox"/> VERBAL <input type="checkbox"/> OVERNIGHT<br><input type="checkbox"/> FAX <input type="checkbox"/> U.S. MAIL |                           |

**0605553**

LABORATORY SUBMITTED TO:

850 Poplar Street  
Pittsburgh, PA 15220  
412/922-4000

☐ OTHER

|  |   |                |
|--|---|----------------|
| RELINQUISHED BY<br>DATE / TIME<br><b>5.30.06</b> | ACCEPTED BY<br>DATE / TIME<br><b>May 31 9:57 AM</b> | SEAL<br>NUMBER |
|--|---|----------------|

| SAMPLE IDENTIFICATION     | DATE / TIME    | AIR-A<br>BULK-B<br>DUST-D<br>HOB-H<br>PAINT-P | SOIL-S<br>VACUUM-V<br>WASTE-W<br>WATER-W<br>WIFE-WP |
|---------------------------|----------------|---|---|
| <b>5-26-06-02, 05, 10</b> | <b>5.26.07</b> | <b>B</b>                                      |   |
| <b>5-26-06-13-14-15</b>   | <b>7</b>       | <b>B</b>                                      |   |

| NUMBER OF CONTAINERS | PARAMETER LIST                 |
|----------------------|--------------------------------|
| <b>3</b> ✓           | <b>PLM</b>                     |
| <b>3</b> ✓           | <b>Analyze Mail 1st Review</b> |

ADDITIONAL REMARKS

**edex 8531-8836 2297**

SAMPLER'S SIGNATURE

Your signature denotes agreement with the PSI General Conditions which are printed on the back side of this document.



**ASBESTOS PROFESSIONAL LICENSE**

ID NUMBER ISSUED EXPIRES  
100 - 09199 4/20/2006

STEFAN M CLOUSE  
2342 REFLECTIONS DR.  
AURORA, IL 60502  
Environmental Health



See Reverse for Endorsements

**ENDORSEMENTS**

**TC EXPIRES**

INSPECTOR

10/5/2006

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

10/6/2006

Alteration of this license shall result in legal action.

This license issued under authority of the State of Illinois - Department of Public Health  
This license is valid only when accompanied by a valid training course certificate

Environmental Health Department of Public Health

If found return to 525 W Jefferson St Springfield, IL 62761



# Amerisafe



## Asbestos Building Inspector Refresher

THIS CERTIFIES THAT  
**Stefan Clouse**

**6773**

Has successfully completed the IL & IN Approved Asbestos Training Course and passed the Examination for purposes of accreditation under section 206 of Title II of the Toxic Substances Control Act (TSCA). Conducted by the Amerisafe Training Services, 3990 Enterprise Court, Aurora IL 60504. (630) 862-2650

CLASS DATE: 10/5/2005

EXAMINATION: 10/5/2005


LOCATION: Amerisafe

EXPIRATION: 10/5/2006

CERTIFICATE NUMBER: 101266X05S100022

DIRECTOR OF SAFETY SERVICES





**ASBESTOS PROFESSIONAL LICENSE**

| ID NUMBER   | ISSUED    | EXPIRES |
|-------------|-----------|---------|
| 100 - 07826 | 4/25/2006 |         |

JEFF D CHAPMAN  
9 OAK LEAF COURT  
WOODRIDGE, IL 60517  
Environmental Health



See Reverse for Endorsements

**ENDORSEMENTS**

**TC EXPIRES**

INSPE CTOR

9/7/2006

PROJECT MANAGER  
AIR SAMPLING PROFESSIONAL

3/9/2007

Alteration of this license shall result in legal action

This license issued under authority of the State of Illinois -Department of Public Health  
This license is valid only when accompanied by a valid training course certificate

Environmental Health      Department of Public Health  
If found return to 525 W. Jefferson St Springfield, IL 62761



## Asbestos Building Inspector Refresher

THIS CERTIFIES THAT  
**Jeff Chapman**

Has successfully completed the IL & IN Approved Asbestos Training Course and passed the Examination for purposes of accreditation under section 206 of Title II of the Toxic Substances Control Act (TSCA). Conducted by the Amerisafe Training Services, 3990 Enterprise Court, Aurora IL 60504. (630) 862-2650

COURSE DATE: 09/07/2005

EXAMINATION: 09/07/2005

LOCATION: Amerisafe

EXPIRATION: 09/07/2006

CERTIFICATE NUMBER: 100001X05S100001

DIRECTOR OF SAFETY SERVICES




United States Department of Commerce  
National Institute of Standards and Technology



ISO/IEC 17025:1999  
ISO 9002:1994

Certificate of Accreditation

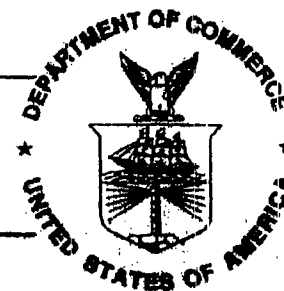

**PSI**  
PITTSBURGH, PA

*is recognized by the National Voluntary Laboratory Accreditation Program  
for satisfactory compliance with criteria set forth in NIST Handbook 150:2001,  
all requirements of ISO/IEC 17025:1999, and relevant requirements of ISO 9002:1994.  
Accreditation is awarded for specific services, listed on the Scope of Accreditation, for:*


**BULK ASBESTOS FIBER ANALYSIS**

June 30, 2006

Effective through

For the National Institute of Standards and Technology  
NVLAP Lab Code: 101350-0

National Institute  
of Standards and Technology

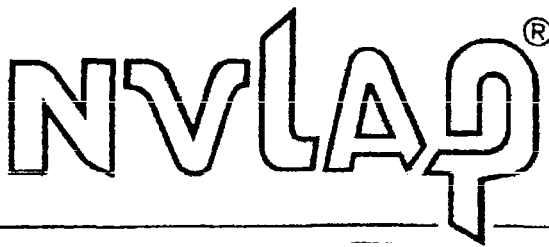

National Voluntary  
Laboratory Accreditation Program

ISO/IEC 17025:1999  
ISO 9002:1994

## Scope of Accreditation



Page: 1 of 1

**BULK ASBESTOS FIBER ANALYSIS**

**NVLAP LAB CODE 101350-0**

**PSI**

850 Poplar Street

Pittsburgh, PA 15220

Ms. Glynnis Bowman

Phone: 412-922-4010 X227 Fax: 412-922-4014

E-Mail: [glynnis.bowman@psiusa.com](mailto:glynnis.bowman@psiusa.com)

URL: <http://www.psiusa.com>

***NVLAP Code***

***Designation***

18/A01

EPA-600/M4-82-020: Interim Method for the Determination of Asbestos in Bulk  
Insulation Samples

June 30, 2006

Effective through

A handwritten signature in black ink, appearing to read "John R. W. [unclear]".

For the National Institute of Standards and Technology

# SDMS US EPA Region V

## Imagery Insert Form

Some images in this document may be illegible or unavailable in SDMS.  
Please see reason(s) indicated below:

Illegible due to bad source documents. Image(s) in SDMS is equivalent to hard copy.

**Specify Type of Document(s) / Comments:**

Includes \_\_\_ COLOR or RESOLUTION variations.

Unless otherwise noted, these pages are available in monochrome. The source document page(s) is more legible than the images. The original document is available for viewing at the Superfund Records Center.

**Specify Type of Document(s) / Comments:**

Confidential Business Information (CBI).

This document contains highly sensitive information. Due to confidentiality, materials with such information are not available in SDMS. You may contact the EPA Superfund Records Manager if you wish to view this document.

**Specify Type of Document(s) / Comments:**

X

Unscannable Material:

Oversized \_\_\_x\_\_\_ or \_\_\_ Format.

Due to certain scanning equipment capability limitations, the document page(s) is not available in SDMS.

**Specify Type of Document(s) / Comments:**

ZION QUADRANGLE – 7.5 MINUTE SERIES TOPOGRAPHIC MAP

Document is available at the EPA Region 5 Records Center.

**Specify Type of Document(s) / Comments:**